

Clamp-On Ground Resistance **Tester**



Instruction **Manual**



Table of Contents

Introduction	3
Product Quality	3
Safety	3
Features	4
Included	4
Specifications	5-6
Instrument Description	7
Display Description	7
Operating Instructions	8-12
Power ON/OFF	8
Auto Power OFF	9
Resistance/Ground Leakage Measurement Mode	9
Resistance Measurement Mode	9-10
Data Hold & Memory Storage	11
Memory Recall	11-12
Setting the Critical Alarms	12
Battery Replacement	13
Product Care	13
Product Warranty	14
Product Disposal and Recycling	14
Product Support	14

Introduction

Thank you for purchasing your REED R5710 Ground Resistance Tester. Please read the following instructions carefully before using your instrument. By following the steps outlined in this manual your meter will provide years of reliable service.

Product Quality

This product has been manufactured in an ISO 9001 facility and has been calibrated during the manufacturing process to meet stated product specifications. If a certificate of calibration is required please contact the nearest authorized REED distributor or authorized Service Center. Please note an additional fee for this service will apply.

Safety

- Never attempt to repair or modify your instrument. Dismantling your product, other than for the purpose of replacing batteries, may cause damage that will not be covered under the manufacturer's warranty.
 Servicing should only be provided by an authorized service center.
- Be aware of your surroundings, environment and measurement scope.
- If the instrument applies to ground resistance testing instead of current power frequency wire it will affect the clamps magnetic property and the accuracy of measurement.
- Before turning on the unit, press on the trigger a couple of times to confirm it can properly open and close.
- Do not press the trigger or clamp any wires when turning on the instrument.
- Only clamp the tested desired object after the display shows "OL Ω ".
- Keep the contact surface of the jaws clean and refrain from using harsh cleaning products.
- When taking measurements the instrument will sporadically "hum".
- Do not exceed the max measurements.
- If instrument will not be used for a prolonged amount of time, remove the battery.
- If something is damaged, immediately stop using the instrument.

Features

- Auto-ranging ground resistance and leakage current measurements
- 0.001Ω resolution for low resistance measurements
- 9999-count EBTN display
- · Internal memory stores up to 300 readings
- · User adjustable alarms
- · Data hold function
- · Durable double molded conductor clamp
- 1.26" (32mm) jaw size for large ground rods
- · Low battery indicator and auto shut off
- · Cat. III 300V safety rating

Included

- Resistance Calibration Loop (1Ω and 10Ω)
- · Hard Carrying Case
- Batteries

Specifications

Ground Resistance

Ranges: $0.010 \text{ to } 0.099\Omega$ $0.10 \text{ to } 0.99\Omega$

1.0 to 49.9Ω 50.0 to 99.5Ω

100 to 199Ω 200 to 395Ω 400 to 590Ω

600 to 880Ω 900 to 1200Ω

Accuracy: $0.010 \text{ to } 0.099\Omega$: $\pm (1\% + 0.01\Omega)$

0.10 to 0.99Ω : $\pm (1\% + 0.01\Omega)$ 1.0 to 49.9Ω : $\pm (1\% + 0.1\Omega)$

50.0 to 99.5 Ω : \pm (1.5% + 0.5 Ω) 100 to 199 Ω : \pm (2% + 1 Ω) 200 to 395 Ω : \pm (5% + 5 Ω) 400 to 590 Ω : \pm (10% + 10 Ω)

600 to 880: $\pm (20\% + 20\Omega)$ 900 to 1200Ω : $\pm (25\% + 30\Omega)$

Resolution: 0.001Ω

0.01Ω 0.1Ω 1Ω 0.5Ω 1Ω 5Ω 10Ω 20Ω 30Ω Current

Ranges: 0 to 9mA

10 to 99mA 100 to 299mA 0.30 to 2.99A 3 to 9.9A 10 to 20A

Accuracy: 0 to 9.95A: ±(2.5% + 1mA)

10 to 99mA: ±(2.5% + 5mA) 100 to 300mA: ±(2.5%10mA) 0.30 to 2.99A: ±(2.5% + 0.1A) 3 to 9.9A: ±(2.5 % + 0.3A) 10 to 20A: ±(2.5 % + 0.5A)

Resolution: 0.5mA, 0.1mA, 1mA, 0.01A, 0.1A, 0.1A

General Specifications

Range Selection: Auto-ranging Sampling Time: 0.5 seconds

Display: 9999 count EBTN display

Backlit LCD: Yes
User Selectable Alarms: Yes
Display Hold: Yes

Internal Memory: Yes up to 300 data points
Auto Shut-off: Yes (after 5 minutes)
Power Supply: 4 x AA Batteries

Jaw Opening:1.26" (32mm)Overvoltage Category:CAT. III 300VProduct Certifications:CE, RoHS

Operating Temperature: 32 to 131°F (0 to 55°C)

Operating Humidity: 10 to 90%

 
Storage Temperature: -4 to 140°F (-20 to 60°C)

Dimensions: 11.2 x 3.3 x 2.2" (285 x 85 x 56mm)

Weight: 2.6lbs (1180g)

Instrument Description

- Clamp Jaw Assembly
- 2. Data Hold Button
- 3. Measurement Trigger
- LCD Display 4.
- Multi-Function Buttons 5.



Display Description



- Noise Signal Indicator 1.
- 2. Data Hold Indicator

Indicator

 
- 3 **Battery Status Indicator**
- Resistance Measurement 4
- 5. Resistance Measurement Value
- Current Measurement Indicator 6.

- Current Measurement Value
- Number of Stored Values
 - Internal Memory Full Indicator
- 10. Data Inquiry Indicator
- 11. Alarm Indicator
- 12. Clamp Jaw Open Indicator

Operating Instructions

Power ON/OFF

- To turn the instrument ON/OFF press the **U** button.
- At power up, the LCD display will light up while displaying the symbols shown below.



 During that time, the instrument will also go through a quick internal calibration and enter resistance/ground leakage measurement mode if it passes. Refer to Resistance/Ground Leakage Measurement Mode for details.

Note: The instrument automatically enters the resistance/earth leakage measurement mode at start up regardless of the last saved setting.

Note: DO NOT clamp on to any conductor or open the clamp jaws during the start-up self-calibration.

 If the instrument does not pass calibration, the LCD display will indicate "ER" as shown below.



Note: This error could be caused by the clamp jaw not being properly closed or from any dirt build up on the metal surface of the jaw clamp.

Distributed By MicroDAQ, LLC

Auto Power OFF

To preserve battery life, the instrument is programmed to turn itself OFF after 5 minutes of inactivity. Prior to the instrument turning OFF, the LCD display will blink for approximately 30 seconds. Press the **b** button to delay the auto power OFF function and resume normal operation.

Resistance/Ground Leakage Measurement Mode

1. When instrument is turned on and passes calibration, "OL Ω " and "0.00 mA" appears on the LCD display as shown below confirming that you can now measure the resistance/earth leakage simultaneously.




- Pull the trigger to open the clamp and clamp onto the circuit under test.
- The LCD will display the resistance and ground leakage current measurement values.
- If the instrument beeps and the LCD display flashes, the measurement values are exceeding the critical set alarm. Refer to Setting the Critical Alarms for details.

Resistance Measurement Mode


- After the instrument has powered up and passed calibration, press the MODE button to enter the resistance only measurement mode.
- 2. "OL Ω " appears on the LCD display as shown below confirming that you can now measure the resistance.



- 3. Pull the trigger to open the clamp and clamp onto the circuit under test.
- The LCD will display the resistance value. 4.
- 5. If the instrument beeps and the LCD display flashes, the resistance measurement is exceeding the critical set alarm. Refer to Setting the Critical Alarms for details.

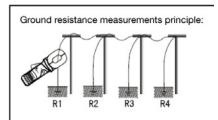

Equivalent circuit diagram:

 

Data Hold & Memory Storage

The instrument has the capability of storing up to 300 values. Stored values are not lost when instrument is turned on or off.

- 1. While taking a measurement, press the **HOLD** button to save the current reading.
- While in this mode "HOLD" will appear along with the current stored 2. value and sequence number.



Press the button again to resume normal operation. 3.

Note: When the Data Hold feature is active the instrument will not turn OFE.

Repeat steps 1 to 3 to hold/store new values during testing. 4.

Note: When the memory is full, "MEM" will flash on the LCD display as shown below.



Memory Recall

 
In order to recall the stored values, you must follow the steps below:

1. Press the **MEM** button to enter memory recall mode and the first stored value will be displayed.



- 2. Press the **AL** and **SET** buttons to scroll through the stored values.
- 3. To clear the stored values, press and hold the MEM button first and then press the **(b)** button.

Note: If no values are stored or if the memory is cleared the display will appear as shown below.



 Press the MEM button to exit memory recall mode and resume normal operation.

Setting the Critical Alarms

- 1. Press the AL button to turn the critical alarm mode ON or OFF.
- Hold the SET button for approximately 3 seconds to enter the critical alarm set up mode.
- 3. Press the **SET** button to toggle between digits.
- 4. Press the AL and MEM buttons to adjust the flashing digit.

Note: The maximum set critical alarm value that can be set is $199\Omega/499mA$.

- Press the SET button to confirm your selection and proceed to the next digit.
- 6. When complete, hold the **SET** button for approximately 3 seconds to exit the critical alarm set up mode and resume normal operation.

Note: When the critical alarm is enabled, the instrument will begin to beep if the measured vale exceeds the selected alarm.

7. Follow steps 2 to 6 to set the critical alarm in mA.

Battery Replacement

When the icon appears on the LCD display, you will need to replace the batteries. Remove the battery cover using a Phillips head screwdriver, insert 4 x new AA batteries and secure the cover.

Product Care

To keep your instrument in good working order we recommend the following:

- Store your product in a clean, dry place.
- · Change the battery as needed.
- If your instrument isn't being used for a period of one month or longer please remove the battery.
- Clean your product and accessories with biodegradable cleaner. Do not spray the cleaner directly on the instrument. Use on external parts only.

Product Warranty

REED Instruments guarantees this instrument to be free of defects in material or workmanship for a period of one (1) year from date of shipment. During the warranty period, REED Instruments will repair or replace, at no charge, products or parts of a product that proves to be defective because of improper material or workmanship, under normal use and maintenance. REED Instruments total liability is limited to repair or replacement of the product. REED Instruments shall not be liable for damages to goods, property, or persons due to improper use or through attempts to utilize the instrument under conditions which exceed the designed capabilities. In order to begin the warranty service process, please contact us by phone at 1-877-849-2127 or by email at info@reedinstruments.com to discuss the claim and determine the appropriate steps to process the warranty.

Product Disposal and Recycling



Please follow local laws and regulations when disposing or recycling your instrument. Your product contains electronic components and must be disposed of separately from standard waste products.

Product Support

If you have any questions on your product, please contact your authorized REED distributor or REED Instruments Customer Service by phone at 1-877-849-2127 or by email at info@reedinstruments.com.

Please visit www.REEDINSTRUMENTS.com for the most up-to-date manuals, datasheets, product guides and software.

Product specifications subject to change without notice. All rights reserved. Any unauthorized copying or reproduction of this manual is strictly prohibited without prior written permission from REFD Instruments.

REED

TEST & MEASURE WITH CONFIDENCE



CHECK OUT OUR LATEST PRODUCTS! Distributed By MicroDAQ, LLC

REED Instruments

603-746-5524 www.MicroDAQ.com

1-877-849-2127 | info@reedinstruments.com | www.reedinstruments.com

REED

INSTRUMENTS



REED Instruments

Distributed By MicroDAQ, LLC 603-746-5524 www.MicroDAQ.com